Electrical contact pressure gauge with aluminium case Model: P531, P532, P533, P534, P537, P539 series

Spec. sheet no. PD05-05

Service intended

P530 series are designed for a local reading of measured pressure and equipped with the inductive contact block which allows all the combinations of contacts to be used. The contact block is mounted on the dial. The window is fitted with a knob for external adjustment of the setpoints.

()

Nominal diameter

100 and 150 mm

Accuracy ±1.5 % of full scale

Scale range (MPa, kPa, bar) -0.1 ~ 0 to -0.1 ~ 2 MPa 0 ~ 0.1 to 0 ~ 100 MPa

Working pressure Steady : 75 % of full scale Over range protection : 130 % of full scale

Working temperature

Ambient : -40 ~ 65 °C Fluid : Max. 100 °C

Temperature effect

Accuracy at temperature above and below the reference temperature (20 $^{\circ}$ C) will be effected by approximately ±0.4 % per 10 $^{\circ}$ C of full scale

Standard features

Pressure connection Stainless steel (316SS)

Element C type bourdon tube Stainless steel (316SS)

Case Black finished aluminium

Cover Black finished aluminium Screwed

Window Acrylic resin Safety glass (P539)

Movement Stainless steel



Dial White aluminium with black graduations

Pointer BsT₃ alloy, black painted pointer with golden plated

Contacts

 $\begin{array}{l} \mbox{Contact rating : AC 110 V, 0.5 A/AC 220 V 0.25 A \\ \mbox{DC 110 V, 0.3 A/DC 220 V 0.15 A} \\ \mbox{Dielectric strength : AC 1,000 V/min} \\ \mbox{Insulation resistance : More than 100 } M\Omega \mbox{ at DC 500 V} \\ \end{array}$

Process connection

¾", ½" PT, NPT and PF

Certificates Pressure equipment directive (2014/68/EU) Annex III Module H



Main order

Ordering information

1. Base model

- P531 High alarm contact type pressure gauge
- P532 High and low alarm contact type pressure gauge
- P533 Low alarm contact type pressure gauge
- P534 Two high alarm contact type pressure gauge
- P537 Two low alarm contact type pressure gauge
- P539 Multi-purpose contact type pressure gauge for transformer, only available with diameter 100 mm

2. Nominal diameter

- 4 100 mm
- 6 150 mm, not available with model P539 series

3. Type of mounting

- Α Bottom connection, direct
- В Bottom connection, surface, case mounting plate, not available with diameter 150 mm
- G Lower back connection, direct, only available with diameter 150 mm and model P539
- L Lower back connection, flush, case center mounting plate, not available with diameter 150 mm
- Μ Lower back connection, flush, cover center mounting bracket, only available with diameter 150 mm

4. Accuracy

4 ±1.5 % of full scale

5. Process connection

- D 3/8"
- Е 1/2", only lower back mounting type

6. Connection type

- В PF
- С PT
- D NPT
- Ζ Other


7. Unit

- н bar
- I. MPa
- J kPa

8. Range

XXX Refer to pressure unit and range table

Sample ordering code





© WISE Control Inc. All rights reserved. ALL PRODUCT, PRODUCT SPECIFICATIONS AND DATA ARE SUBJECT TO CHANGE WITHOUT NOTICE TO IMPROVE RELIABILITY, FUNCTION OR DESIGN OR OTHERWISE.


9. Pressure connection material and dial color

- 316SS and 2 colors 3
- 7 316SS and 3 colors

10. Option

- 0 None
- 1 Accessories

P53X : Type of mounting

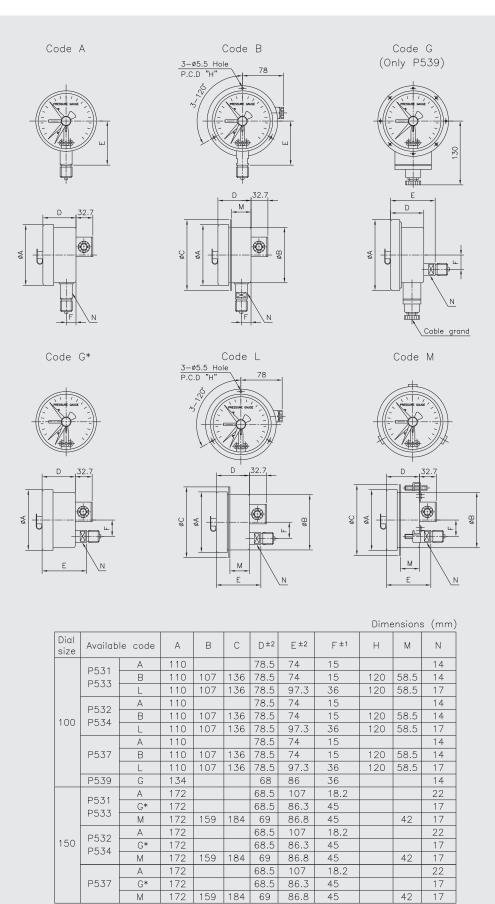

UISE[®] | P530 Series_03

Snap - action contacts

General

Electromechanical limit switches in pointer type measuring instruments are auxiliary current switches which open or close electrical circuits at set limit values by means of a contact arm which is moved by the actual value pointer.

The snap action contact is a mechanical contact for switching capacities up to 30 W 50 VA max.

Contact making will be delayed and or advanced in relation to the movement of the actual value pointer.

To closed the circuit, the contact pin of the movable contact arm is attracted in a jump by the permanent magnet fastened to the supporting arm shortly before the set value has been reached.

Due to the retention force of the magnet, snap action contacts are more resistant against shock and vibration. The switching safety is increased by the increased contact pressure.

When the citcuit is opened, the magnet keeps the contact arm in its place until the restoring force of the measuring element exceeds the magnetic force, and the contact opens in a jump.

Specifications

Maximum contact rating with non-inductive (ohmic) load Maximum voltage		Electrical contacts type pressure gauge model P530 series			
		Dry gauges			
		250 V			
Current ratings	Make ratings	1.0 A			
	Break ratings	1.0 A			
	Continuos load	0.6 A			
Maximum load		30 W 50 VA			
Material of contact points		Silver-Nickel alloy (80 % Ag / 20 %Ni / 10 //m) gold-plated			
Ambient operating temperature		-20 °C+70 °C			
Max. no. of contacts		2			
Voltage test		Circuit / protective earth conductor - 2,000 vac 1 minute Circuit /circuit - 2,000 vac 1 minute			

Recommended contact ratings with ohmic and inductive load


	Electrical conta	Electrical contacts type pressure gauge model P530 series			
Voltage (DIN IEC 38) DC / AC	Dry gauges				
	Ohmi	c load	Inductive load		
	DC	AC			
			cosØ > 0.7		
V	mA	mA	mA		
220 / 230	100	120	65		
110 / 110	200	240	130		
48 / 48	300	450	200		
24 / 24	400	600	250		

In order to ensure a high switching reliability of the contacts the switching voltage should not be below 24 V, also taking environmental influences in the long term into account.



SPST switching element

Single-pole, single throw (SPST) has two connection : C-common, NO-normally open, which allows the switching element to be electrically to the circuit NO state.

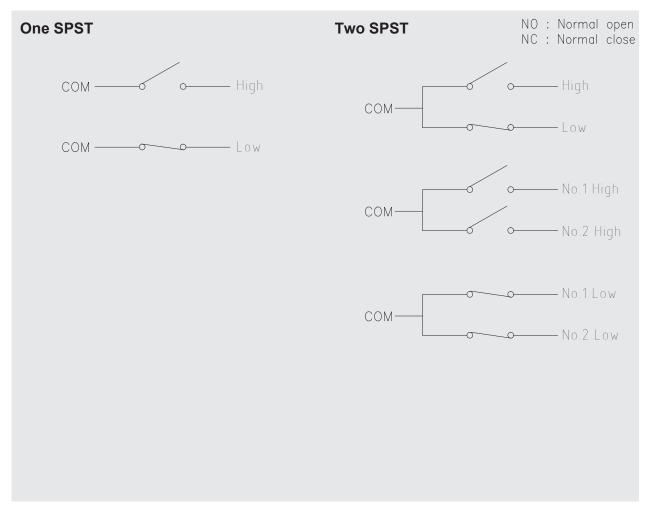



Range and code		Unit and code	P531, P532, P533, P534, P537		P539	
	H : bar	I : MPa	J : kPa	100 mm	150 mm	100 mm
026	-1 ~ 0	-0.1 ~ 0	-100 ~ 0	0	0	0
040	0 ~ 0.5	0~0.05	0 ~ 50	0	X	0
041	0~1	0 ~ 0.1	0 ~ 100	0	0	0
042	0~2	0~0.2	0 ~ 200	0	0	0
043	0~3	0 ~ 0.3	0 ~ 300	0	0	0
044	0~4	0 ~ 0.4	0 ~ 400	0	0	0
045	0~6	0~0.6	0 ~ 600	0	0	0
047	0~10	0~1	0 ~ 1,000	0	0	0
050	0~15	0~1.5	X	0	0	0
051	0 ~ 20	0~2	X	0	0	0
052	0 ~ 25	0~2.5	X	0	0	0
054	0 ~ 35	0 ~ 3.5	X	0	0	0
055	0 ~ 50	0~5	X	0	0	0
057	0 ~ 70	0~7	X	0	0	0
058	0 ~ 100	0~10	X	0	0	0
059	0 ~ 150	0~15	X	0	0	0
062	0 ~ 250	0~25	X	0	0	0
064	0 ~ 350	0~35	X	0	0	0
066	0 ~ 500	0~50	X	0	0	0
068	0 ~ 700	0~70	X	0	0	0
070	0~1,000	0~100	X	0	0	0
027	-1 ~ 1	-0.1 ~ 0.1	-100 ~ 100	0	0	0
028	-1 ~ 2	-0.1 ~ 0.2	-100 ~ 200	0	0	0
029	-1 ~ 3	-0.1 ~ 0.3	-100 ~ 300	0	0	0
030	-1 ~ 4	-0.1 ~ 0.4	-100 ~ 400	0	0	0
031	-1 ~ 6	-0.1 ~ 0.6	-100 ~ 600	0	0	0
032	-1 ~ 10	-0.1 ~ 1	-100 ~ 1,000	0	0	0
033	-1 ~ 15	-0.1 ~ 1.5	-100 ~ 1.5 MPa	0	0	0
034	-1 ~ 20	-0.1 ~2	-100 ~ 2 MPa	0	0	0

Pressure unit and range table

O : Available X : Not available

