

MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 0.2...0.33A



Product designation			11RF9
Product type designation			Motor protection relay
General characteristics			
Number of poles		Nr.	3
Overvoltage category			III
Pollution degree			3
Frontal IP degree			IP20
Type of release			Thermal
Protection fuse			
	gG (IEC)	Α	1
	aM (IEC)	Α	0.5
	RK5 (UL)	Α	1
Phase failure detection			yes
Reset mode			Manual
Power circuit characteristics			
Rated insulation voltage Ui IEC/EN		V	690
Rated impulse withstand voltage Uimp		kV	8
Rated operational voltage		V	690
Operational frequency			
	min	Hz	0
	max	Hz	400
Operational current le			
•			
	Operational current min	Α	0.2
	Operational current min Operational current max	A A	0.2 0.33
Tripping class	Operational current min Operational current max	A A	0.33
Tripping class Test Button			0.33 10A
Test Button			0.33 10A yes
Test Button Trip indicator			0.33 10A
Test Button	Operational current max		0.33 10A yes yes
Test Button Trip indicator			0.33 10A yes yes screw and
Test Button Trip indicator	Operational current max		0.33 10A yes yes
Test Button Trip indicator	Operational current max  type screw		0.33 10A yes yes screw and washer M4
Test Button Trip indicator	Operational current max type	A	0.33 10A yes yes screw and washer M4 9.8
Test Button Trip indicator Terminals	Operational current max  type screw width	A	0.33 10A yes yes screw and washer M4
Test Button Trip indicator	Operational current max  type screw width	A	0.33 10A yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	type screw width tool min	Mm Nm	0.33 10A yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	type screw width tool min max	mm Nm Nm	0.33 10A yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3
Test Button Trip indicator Terminals	type screw width tool min	Mm Nm	0.33 10A yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	type screw width tool min max min	mm Nm Nm Ibin	0.33 10A yes yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7
Test Button Trip indicator Terminals  Tightening torque for terminals	type screw width tool min max min	mm Nm Nm Ibin	0.33 10A yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals  Tightening torque for terminals  Conductor section	type screw width tool min max min max min max	mm Nm Nm Ibin	0.33 10A yes yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7
Test Button Trip indicator Terminals  Tightening torque for terminals  Conductor section  Auxiliary circuit characteristics	type screw width tool min max min max min max	mm Nm Nm Ibin	0.33 10A yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals  Tightening torque for terminals  Conductor section	type screw width tool min max min max AWG/kcmil max	mm Nm Nm Ibin Ibin	0.33 10A yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals  Tightening torque for terminals  Conductor section  Auxiliary circuit characteristics	type screw width tool min max min max min max	mm Nm Nm Ibin	0.33 10A yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7




MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 0.2...0.33A


Auxiliary Rated insulation voltage Ui IEC/EN		V	690
Auxiliary Rated insulation voltage of Ec/EN  Auxiliary Rated impulse withstand voltage Uimp		kV	6
Auxiliary Rated impulse withstand voltage omp		V	690
Operating current AC15		V	090
Operating current AO13	24V	Α	3
	120V	A	3
	240V	A	1.5
	380V	A	0.95
	480V	A	0.75
	500V	Α	0.72
	600V	Α	0.6
Operating current DC13			
9	125V	Α	0.11
	600V	Α	0.22
IEC Conventional free air thermal current Ith		Α	10
Terminals			
	A 11' - 1 14 4		screw and
	Auxiliary circuit type		washer
	Auxiliary circuit screw		M3,5
	Auxiliary circuit width	mm	8
	Auxiliary circuit tool		Phillips 1
Conductor section			
	Auxiliary circuit Flexible w/o lug max	mm²	2.5
	Auxiliary circut Flexible c/w lug max	mm²	2.5
Tightening torque for terminals			_
	Auxiliary circuit min	Nm	1
	Auxiliary circuit max	Nm	1
	Auxiliary circuit min	lbin	0.74
	Auxiliary circuit max	lbin	0.74
UL/CSA and IEC/EN 60947-5-1 designation			B600-P600
Ambient conditions			
Operating temperature			
	min	°C	-20
·-	max	°C	55
Storage temperature			
	min	°C	-55
	max	°C	70
Compensation temperature	_	2.5	4.5
	min	°C	-15 
Many altituda	max	°C	55
Max altitude		m	3000
Mechanical features			
Operating position			Vertical plan
	normal		Vertical plan ±30°
	allowable		
Fixing			Direct mounting on BG06
			BG09 BG12
Weight		g	116
UL technical data			
Full-load current (FLA) for three-phase AC motor		_	
	at 480V	Α	0.33
Directories from (in)	at 600V	Α	0.33
Dimensions [mm (in)]			

ENERGY AND AUTOMATION

MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 0.2...0.33A

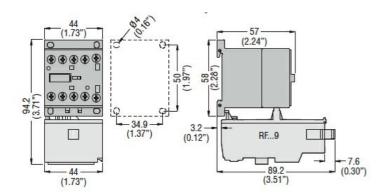

## Wiring diagrams

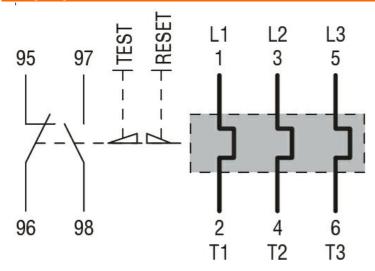

## Certifications and compliance

Compliance

CSA C22.2 n° 14

IEC/EN 60947-1

IEC/EN 60947-4-1

UL508

Certifications

CCC

CSA

cULus

EAC

ETIM classification

ETIM 8.0

EC000106 -

Thermal overload

relay